



PROBLEM SOLVER[®] BULLETIN

Upper Ball Joint Replacement

www.moogproblemsolver.com

2005-2007 Cadillac STS,
2004-2007 SRX

PROBLEM:

OE front upper ball joint only available as part of upper control arm/spring mount assembly

When it is necessary to replace the upper ball joint on these vehicles, the OEM upper ball joint cannot be ordered separately from the dealer. It is only available as part of the complete aluminum control arm/spring mount assembly.



REPLACE WITH K500065


Upper Control Arm/Spring Mount Assembly

Description	Years	Make/Model	Part Number
Upper Ball Joint	2004-2007	Cadillac SRX	K500065
	2005-2007	Cadillac STS	

SOLUTION:

MOOG[®] K500065 Upper Ball Joint

The MOOG K500065 upper ball joint is available as a separate component, so the control arm assembly does not have to be purchased to replace the ball joint. The MOOG premium K500065 resin-plated housing helps prevent galvanic corrosion between the aluminum control arm and ball joint housing. Its problem solving and serviceable design aids in longer life.

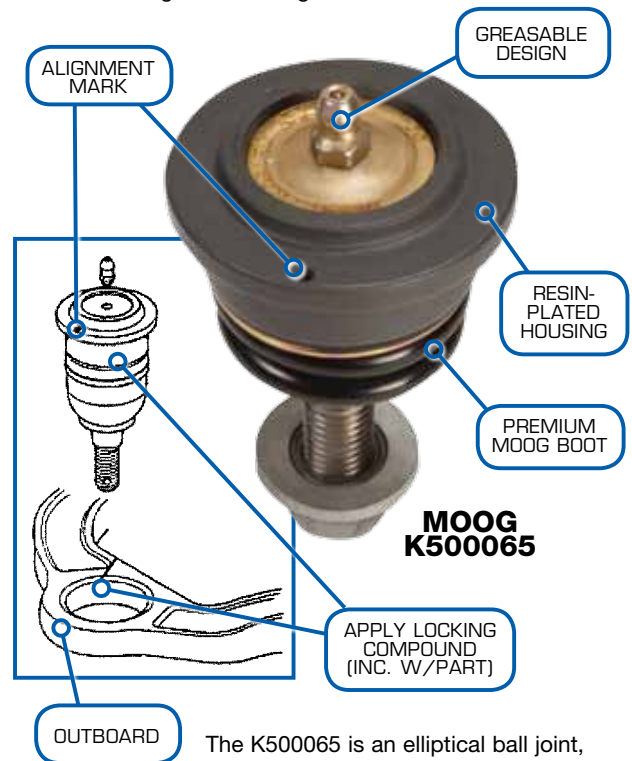

MOOG K500065

The K500065 is an elliptical ball joint, and requires special orientation when installing. See Problem Solver Bulletin 217028-R. Please be sure to refer to the instruction sheet included with the part



THE PROBLEM SOLVER[®]

